



\*INVOICE\*

79200 Varner Road  
Indio, CA 92203  
(760) 345-1000  
Service Direct (760) 797-8945  
Service Fax (760) 614-6009  
www.i10dodge.com

PAGE 1

BAR #286165 EPA# CAL000425111

SERVICE ADVISOR: 360 RAMON Z ROCHIN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
	03	DODGE VIPER	1B3JR65ZX3V500924		9041/9041	T3994	
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
24APR03 DD			18:00 17OCT22		165.00	CASH	20OCT22
R.O. OPENED		DATE CUST. NOTIFIED	OPTIONS: DLR:26967				
17:31 17OCT22		15:05 20OCT22					

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

A General Concern #1 [CUSTOMER STATES VEHICLES CLUTCH PEDAL WILL STINK TO FLOOR WHEN OPERATING INTERMITTANT ISSUE CHECK AND ADVISE]  
 CAUSE: AFTERMARKET MODIFICATION FOR EXHAUST MANIFOLDS  
 01 General Concern #1 [CUSTOMER STATES VEHICLES CLUTCH PEDAL WILL STINK TO FLOOR WHEN OPERATING INTERMITTANT ISSUE CHECK AND ADVISE]  
 530 ISP (N/C)


9041 PERFORMED INSPECTION ON VEHICLE FOUND CLUTCH LINE TOO CLOSE TO CUSTOMER INSTALLED AFTERMARKET EXHAUST MANIFOLDS .LINE BEING TOO CLOSE TO MANIFOLD WAS CAUSING CLUTCH LINE FLUID TO ABSORB EXCESSIVE HEAT AND AS A RESULT PROVIDED INADEQUATE FLUID VISCOSITY TO CLUTCH MASTER CYLINDER CAUSING INTERMITTENT CLUTCH PEDAL FAILURE AND UNABLE TO ENGAGE PROPERLY, CUSTOMER ADVISED AND UNDERSTOOD CUSTOMER TO TOW VEHICLE FOUND OF DEALERSHIP.

\*\*\*\*\*  
 B PERFORM MULTI POINT INSPECTION CHECK TIRE PRESSURE L/F R/F R/R L/R  
 CAUSE: VEHICLE INSPECTION  
 DECL Customer declined recommended repairs at this time  
 530 ISP (N/C)  
 \*\*\*\*\*

\*\*\*\*\*  
 ESTIMATE: 165.00 17OCT22 17:31 SA: 360  
 CONTACT:  
 \*\*\*\*\*

SERVICE HOURS 7AM-6PM M-F 8-4 SATURDAY  
 CONVENIENT AFTER HOURS DELIVERY (SEE ADVISOR)  
 2 TRANSPORTATION OPTIONS SPECIAL RENTAL RATES  
 AND SHUTTLE SERVICE.

<b>THANK YOU</b>  FOR BRINGING YOUR CAR TO US FOR SERVICE  IF YOU ARE HAPPY LET YOUR NEIGHBOR KNOW. IF YOU ARE UNHAPPY CALL YOUR SERVICE ADVISOR AT ONCE.	ORIGINAL ESTIMATE:	AUTHORIZED REVISED ESTIMATE:	DESCRIPTION	TOTALS
	\$	\$	LABOR AMOUNT	0.00
	"By law, you may choose another licensed Smog check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary."		PARTS AMOUNT	0.00
	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		GAS, OIL, LUBE	0.00
	CUSTOMER INITIAL		SUBLET AMOUNT	0.00
	I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.		MISC./HAZ. MAT. CHGS.	0.00
	CUSTOMER SIGNATURE		TOTAL CHARGES	0.00
			ADJUSTMENTS	0.00
			SALES TAX	0.00
			PLEASE PAY THIS AMOUNT	0.00

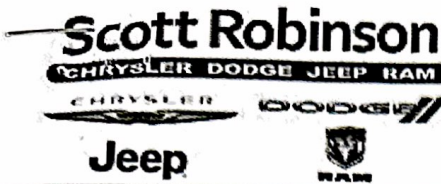

**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197




Year/Make/Model: 2003 Dodge VIPER		A/R Number:	Invoice Number
VIN: <b>1B3JR65ZX 3V500924</b>		Customer Number:	<b>340876</b>
License Number: _____ Color: _____		PO Number:	Printed: AUG 9 22 2:55 PM
Stock Number: _____ Mileage In: 7948		Auth Number:	Copy # 2
Tag Number: <b>1386</b> Mileage Out: 7954		Service Writer: Anthony Morales	Date Opened: 07/27/22
		Terms & Conditions:	Date Notified: 07/29/22
		Type of Sale: Retail	Date Delivered: 07/29/22
I acknowledge notice and oral approval of an increase in the original estimated price.			
Customer Signature _____			

Incr. Amt	New Amt	Date	Time	Person Cont.	How Cont.	Phone	Cont. By
1400.00	1600.00	07/28/22	3:14PM	Amir	Phone	3107100703	990489
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix							
1500.00	3100.00	08/09/22	2:53PM	In Person			
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100							

Reason:

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
<b>1. Customer statement of problem</b>					
USED CAR INSPECTION - All fluids to be checked also					
1 - Cause/Action to Take					
UCI - perform used car inspection.					
1 - Correction/Action Taken					
performed use car inspection- checked all fluid levels and conditons, checked suspetion, checked drive line, inspected brakes.					
Part Number					
5GC71DX9AA					
Description					
NONE PIN	990040				1.55
<u>Sub Total Parts</u>					0.00
<u>Miscellaneous Charges and Deductions</u>					
Hazordous Waste Internal					
SubTotal Job # 1					-10.00
					-8.45
<b>2. Customer statement of problem</b>					
REPLACE 4 TIREScheck TPMS light was on					
1 - Cause/Action to Take					
T4 - tire lamp on- and cust intrested in tires.					
1 - Correction/Action Taken					
tested tire pressure sensors- right rear tire pressure sensor failure.					
Part Number					
68406527AA					
Description					
SENSOR-TIRE PRESSURE	990040				400.00
<u>Sub Total Parts</u>					100.00
<u>Miscellaneous Charges and Deductions</u>					
Tire Disposal Fee 4 Tires					
SubTotal Job # 2					16.00
					516.00
<b>3. Customer statement of problem</b>					
Customer Requests 2nd Key FOB					
1 - Cause/Action to Take					
S150 - cust request request to program - cust provided fob.					
1 - Correction/Action Taken					
programmed new ( cust provided ) fob and re-prgramed old fob- verified					
	990040				100.00

**VEHICLE PICKED UP**  
**AUG 09 2022**

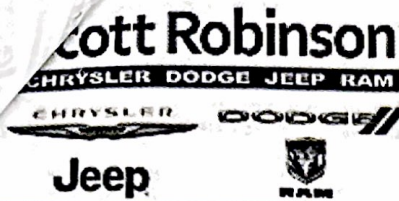

**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197




Year/Make/Model: 2003 Dodge VIPER		A/R Number:	Invoice Number
VIN: 1B3JR65ZX 3V500924		Customer Number:	<b>340876</b>
License Number: _____ Color: _____		PO Number:	Printed: AUG 9 22 2:55 PM
Stock Number: _____ Mileage In: 7948		Auth Number:	Copy # 2
Tag Number: 1386 Mileage Out: 7954		Service Writer: Anthony Morales	Date Opened: 07/27/22
		Terms & Conditions:	Date Notified: 07/29/22
		Type of Sale: Retail	Date Delivered: 07/29/22
I acknowledge notice and oral approval of an increase in the original estimated price.			
Customer Signature _____			

Original Estimate: \$200.00		Original Estimate: 07/27/22	
<u>Incr. Amt</u>	<u>New Amt</u>	<u>Date</u>	<u>Time</u>
1400.00	1600.00	07/28/22	3:14PM
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix			
1500.00	3100.00	08/09/22	2:53PM
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100			
		<u>Person Cont.</u>	<u>How Cont.</u>
		Amir	Phone
			Phone 3107100703
			<u>Cont. By</u>
			990489

Reason:

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
both fobs operation.					
<u>Sub Total Parts</u>					0.00
SubTotal Job # 3					100.00
<b>4. Customer statement of problem</b>					
Replace/Repair Hood latch handle					
1 - Cause/Action to Take					
S110 - hood release handle broken.					
cust request to install cust provided hood handle.					
1 - Correction/Action Taken					
cust provided new mopar hood release handle.					
installed new release handle and verified proper op.					
990040					140.00
<u>Sub Total Parts</u>					0.00
SubTotal Job # 4					140.00
<b>5. Customer statement of problem</b>					
Pedals will not move with the switch					
1 - Cause/Action to Take					
S150 - cust state adjustable pedals inop.					
1 - Correction/Action Taken					
checked and verified pedal adjustment inop.					
removed knee bolster and inspected found pedal adjuster switch disconnected,					
checked and verified good power and ground at pedal switch connector.					
cleaned connector and reconnected- verified good connection and verified proper system op.					
990040					100.00
<u>Sub Total Parts</u>					0.00
SubTotal Job # 5					100.00
<b>6. Customer statement of problem</b>					
Powersteering making noise. Filled with fluid and now is leaking. Pump may need to be replaced					
1 - Cause/Action to Take					
DRV - cust states possible ps leak and noise.					
1 - Correction/Action Taken					
inspected to find fluid over full- leakage could be due to overfull.					
performed power steering fluid service see line 13- during which					
990040					0.00

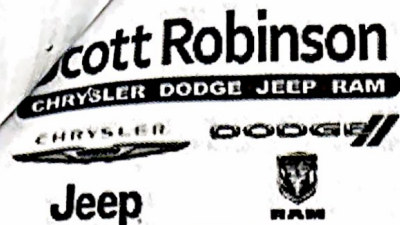

**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER		A/R Number:	Invoice Number
VIN: <b>1B3JR65ZX 3V500924</b>		Customer Number:	<b>340876</b>
License Number: _____ Color: _____		PO Number:	Printed: AUG 9 22 2:55 PM
Stock Number: _____ Mileage In: 7948		Auth Number:	Copy # 2
Tag Number: <b>1386</b> Mileage Out: 7954		Service Writer: Anthony Morales	Date Opened: 07/27/22
		Terms & Conditions:	Date Notified: 07/29/22
		Type of Sale: Retail	Date Delivered: 07/29/22
I acknowledge notice and oral approval of an increase in the original estimated price.			
Customer Signature _____			

Original Estimate: \$200.00		Original Estimate: 07/27/22	
<u>Incr. Amt</u>	<u>New Amt</u>	<u>Date</u>	<u>Time</u>
1400.00	1600.00	07/28/22	3:14PM
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix			
1500.00	3100.00	08/09/22	2:53PM
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100			
		<u>Person Cont.</u>	<u>How Cont.</u>
		Amir	Phone
			Phone 3107100703
			<u>Cont. By</u>
			990489
Reason:			

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
monitored for power steering noise- no noise at this time., cleaned ps pump and res.					
<u>Sub Total Parts</u>					<u>0.00</u>
SubTotal Job # 6					0.00
<b>7. Customer statement of problem</b>					
Replace driver side interior trim piece on door, "FLAG" trim piece					
1 - Cause/Action to Take					
DRV - interior rubber torn on drivers side flag panel. cust reqest to install cust provided used flag panel.					
1 - Correction/Action Taken					
removed drivers door panel and inspected - found window regualtor plastic channel broken at motor- removal could make window regualtor no longer work.			990040		<u>0.00</u>
need to remove to access flag panel- cust going to find drivers window regualtor and return with regulator and flag panel.					
reinstalled door panel.					
<u>Sub Total Parts</u>					<u>0.00</u>
SubTotal Job # 7					0.00
<b>8. Customer statement of problem</b>					
Replace Trunk shocks. Also trunk sticks and wont lock sometimes.					
1 - Cause/Action to Take					
DRV - cust request to install provided trunk shocks and at times trunk not locking.					
1 - Correction/Action Taken					
installed cust provided trunk props.			990040		<u>0.00</u>
checked trunk latch operation- tested 8 times opens and closes/ locks properly at this time.					
<u>Sub Total Parts</u>					<u>0.00</u>
SubTotal Job # 8					0.00
<b>9. Customer statement of problem</b>					
Glove box wont close					
1 - Cause/Action to Take					
DRV - glove box hard to close.					



**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER VIN: 1B3JR65ZX 3V500924 License Number: _____ Color: _____ Stock Number: _____ Mileage In: 7948 Tag Number: 1386 Mileage Out: 7954	A/R Number:	Invoice Number <b>340876</b> Printed: AUG 9 22 2:55 PM Copy # 2 Date Opened: 07/27/22 Date Notified: 07/29/22 Date Delivered: 07/29/22
	Customer Number:	
	PO Number:	
	Auth Number:	
	Service Writer: Anthony Morales	
	Terms & Conditions:	
Type of Sale: Retail	I acknowledge notice and oral approval of an increase in the original estimated price.	
Customer Signature _____		

Original Estimate: \$200.00	Original Estimate: 07/27/22						
<b>ncr. Amt</b>	<b>New Amt</b>	<b>Date</b>	<b>Time</b>	<b>Person Cont.</b>	<b>How Cont.</b>	<b>Phone</b>	<b>Cont. By</b>
1400.00	1600.00	07/28/22	3:14PM	Amir	Phone	3107100703	990489
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix							
1500.00	3100.00	08/09/22	2:53PM	In Person			
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100							

Reason: \_\_\_\_\_

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
<b>1 - Correction/Action Taken</b> inspected and found glove box latch catch loop loose, found left screw nut plate loose, retaining plastic broken. cust authorized to attempt to make repair.  fabricated screw nut plate retainer tab. installed nut plate onto retainer tab. installed nut plate/ retainer tab. and reinstalled latch loop, verified proper glove box latching at this time. <u>Sub Total Parts</u> SubTotal Job # 9					500.00
<b>10. Customer statement of problem</b> Suggested Tune Up 1 - Cause/Action to Take DRV - cust inquired about condition of spark plugs. 1 - Correction/Action Taken cust also mentioned that cyl #3 might have had plug replaced- inspected and verified cyl #3 has new spark plug- pulled plug from cyl #5 , #4 and #6 and verified all those cylinders also have new plugs- spark plug ignition wire set original from 2003- installed new ignitiion wire set. <u>Sub Total Parts</u> SubTotal Job # 10					400.00
<b>11. Customer statement of problem</b> ICHRY Vehicle Inspection 1 - Cause/Action to Take ICHRY - Inspection 1 - Correction/Action Taken Performed Multi point inspection <u>Sub Total Parts</u> SubTotal Job # 11					0.00
<b>12. Customer statement of problem</b> TIRE INFLATED TO (PSI) RIGHT FRONT _____ LEFT FRONT _____ RIGHT REAR _____ LEFT REAR _____ TECH (_____) 1 - Cause/Action to Take					



**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197




Year/Make/Model: 2003 Dodge VIPER		A/R Number:	Invoice Number
VIN: 1B3JR65ZX 3V500924		Customer Number:	<b>340876</b>
License Number: Color:		PO Number:	Printed: AUG 9 22 2:55 PM
Stock Number: Mileage In: 7948		Auth Number:	Copy # 2
Tag Number: 1386 Mileage Out: 7954		Service Writer: Anthony Morales	Date Opened: 07/27/22
		Terms & Conditions:	Date Notified: 07/29/22
		Type of Sale: Retail	Date Delivered: 07/29/22
I acknowledge notice and oral approval of an increase in the original estimated price.			
Customer Signature			

Incr. Amt	New Amt	Date	Time	Person Cont.	How Cont.	Phone	Cont. By
1400.00	1600.00	07/28/22	3:14PM	Amir	Phone	3107100703	990489
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix							
1500.00	3100.00	08/09/22	2:53PM	In Person			
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100							

Reason:

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
PSI - PSI 1 - Correction/Action Taken Set all tires to specified air pressure					0.00
<u>Sub Total Parts</u>					0.00
SubTotal Job # 12					0.00
<b>13. Customer statement of problem</b>					
PERFORM POWER STEERING FLUID EXCHANGE SERVICE. DEALER RECOMMENDED/CUSTOMER APPROVED					
1 - Cause/Action to Take					
PSF - Maint					
1 - Correction/Action Taken					
Performed power steering exchange and set fluid level.					
	990040				192.69
Part Number					
AD77R					
Description					
PS SERVICE (RED)	1	1	57.31	57.31	
<u>Sub Total Parts</u>					57.31
SubTotal Job # 13					250.00
<b>14. Customer statement of problem</b>					
PERFORM BRAKE FLUID EXCHANGE SERVICE. DEALER RECOMMENDED/CUSTOMER APPROVED					
1 - Cause/Action to Take					
BFF - brake fluid found to have exesive moisture during inspection.					
1 - Correction/Action Taken					
performed brake fluid exchange- due to brembo brake calipers with large fluid capasicy and bleeders on inner and outter capliper halves- required to use 2 brake fluid bottles.					
	990040				298.50
Part Number					
DOT4					
Description					
BRAKE FLUID	2	2	50.75	101.50	
<u>Sub Total Parts</u>					101.50
SubTotal Job # 14					400.00
<b>15. Customer statement of problem</b>					
Install customer provided K&N air intake					
1 - Cause/Action to Take					
S190 - cust request to install cust provided k&n cold air intake					
1 - Correction/Action Taken					
removed factory air intake.					
	990040				280.00

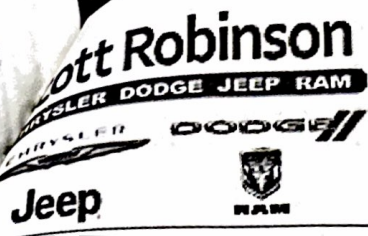

**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER VIN: 1B3JR65ZX 3V500924 License Number: _____ Color: _____ Stock Number: _____ Mileage In: 7948 Tag Number: 1386 Mileage Out: 7954	A/R Number:	Invoice Number
	Customer Number:	<b>340876</b>
	PO Number:	Printed: AUG 9 22 2:55 PM
	Auth Number:	Copy # 2
	Service Writer: Anthony Morales	Date Opened: 07/27/22
	Terms & Conditions:	Date Notified: 07/29/22
Type of Sale: Retail	Date Delivered: 07/29/22	
I acknowledge notice and oral approval of an increase in the original estimated price.		
Customer Signature _____		

Original Estimate: \$200.00	Original Estimate: 07/27/22						
<b>Inc. Amt</b>	<b>New Amt</b>	<b>Date</b>	<b>Time</b>	<b>Person Cont.</b>	<b>How Cont.</b>	<b>Phone</b>	<b>Cont. By</b>
1400.00	1600.00	07/28/22	3:14PM	Amir	Phone	3107100703	990489
Reason: \$400 Brake flush - \$100 Pedal Fix - \$250 PS flush - \$500 Glove box fix							
1500.00	3100.00	08/09/22	2:53PM		In Person		
Reason: hood release \$140 tires \$500 Wires \$400 K&N \$300 key fob \$100							

Reason:

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
installed k&n cold air intake.					
<u>Sub Total Parts</u>					0.00
SubTotal Job # 15					280.00
<u>Miscellaneous Charges and Deductions For All Jobs</u>					
HAZARDOUS WASTE65					10.00

Payment in full required prior to release of vehicle.  
 Method of payment we accept: Cash Mastercard Visa Amex  
 Company or Personalized check up to \$2,000.00 with the following:  
 1) C Check guarantee card  
 2) V Valid drivers license  
 3) N Name and address  
 (No. P.O. imprinted on check)

Total Labor	2,412.74
Total Parts	258.81
Total Sublet	0.00
Misc. Chrgs	16.00
Car Rental	0.00
Freight	0.00
Deductible	0.00
Special Tax	0.00
Haz Mat Chrg	0.00
Sales Tax	24.59

Customer Signature X

**AMOUNT DUE 2,712.14**

Prop 65 - Warning Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain Replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleansing your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: http://www.oehha.org/prop65.html.

**Scott Robinson Chrysler Dodge Jeep Ram**  
20900 Hawthorne Blvd  
Torrance , CA 90503  
(855) 301-2211

**RECEIPT**

**Customer Information:**

**Invoice Details:**  
Invoice #: 386NTNRDT7  
Invoice Date: Tuesday, August 09,  
2022 03:46 PM

Repair Order/Ref #: 340876

---

**Description of Product/Services**

**Amount**

\$ 2712.14

---

**Payment Details:**

Paid On: Tuesday, August 09, 2022 03:47 PM

Card Type: Visa  
Payment Type: Debit

Dealer Associate: Anthony Morales  
Cashier: Anthony Morales

-----  
-----  
Customer Signature

THANK YOU!

---

Scott Robinson Chrysler Dodge Jeep Ram

Processed by myKaarma eBridge  
Payments



# Scott Robinson

CHRYSLER DODGE JEEP RAM

CHRYSLER DODGE JEEP RAM



## Scott Robinson Chrysler Dodge Jeep Ram

20900 Hawthorne Blvd  
Torrance, CA 90503

(310) 542-0900

www.scottrobinsonchryslerdodgejeepram.com

B.A.R. # ARD269409 EPA # CAD981574197




Year/Make/Model: 2003 Dodge VIPER VIN: <b>1B3JR65ZX 3V500924</b> License Number: _____ Color: _____ Stock Number: _____ Mileage In: 8521 Tag Number: <b>1272</b> Mileage Out: 8522	A/R Number:	Invoice Number <b>342924</b>
	Customer Number:	Printed: SEP 9 22 1:25 PM
	PO Number:	Copy # 1
	Auth Number:	Date Opened: 09/09/22
	Service Writer: Anthony Morales	Date Notified: 09/09/22
	Terms & Conditions:	Date Delivered: 09/09/22
Type of Sale: Retail	I acknowledge notice and oral approval of an increase in the original estimated price.	
Customer Signature _____		

Incr. Amt	New Amt	Date	Time	Original Estimate:	Person Cont.	How Cont.	Phone	Cont. By
				Original Estimate: \$ 0.00				
Reason:								
Reason:								
Reason:								

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
<b>1. Customer statement of problem</b>					
General Concern #1 [Customer States drivers inner door handle gets stuck open and door panel squeaks after last repair]					
1 - Cause/Action to Take					
S150 - interior door handle getting stuck.					
1 - Correction/Action Taken					
removed door panel and inspected - found release cable popped out of door handle retainer.			990040		0.00
reinstalled cable.					
reinstalled door panel.					
checked and verified proper operation.					
<u>Sub Total Parts</u>					<u>Warranty</u>
SubTotal Job # 1					Warranty
<b>2. Customer statement of problem</b>					
ICHRV Vehicle Inspection					
1 - Cause/Action to Take					
ICHRV - Inspection					
1 - Correction/Action Taken					
Performed Multi point inspection			990040		0.00
<u>Sub Total Parts</u>					<u>0.00</u>
SubTotal Job # 2					0.00
<b>3. Customer statement of problem</b>					
TIRE INFLATED TO (PSI) RIGHT FRONT _____ LEFT FRONT _____ RIGHT					
REAR _____ LEFT REAR _____ TECH (_____)					
1 - Cause/Action to Take					
PSI - PSI					
1 - Correction/Action Taken					
Set all tires to specified air pressure			990040		0.00
<u>Sub Total Parts</u>					<u>0.00</u>
SubTotal Job # 3					0.00

Miscellaneous Charges and Deductions For All Jobs

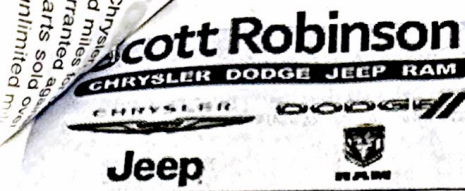

**Scott Robinson Chrysler Dodge Jeep Ram**  
 20900 Hawthorne Blvd  
 Torrance, CA 90503  
 (310) 542-0900  
 www.scottrobinsonchryslerdodgejeepram.com  
 B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER VIN: 1B3JR65ZX 3V500924 License Number: _____ Color: _____ Stock Number: _____ Mileage In: 8521 Tag Number: 1272 Mileage Out: 8522	A/R Number:	Invoice Number <b>342924</b> Printed: SEP 9 22 1:25 PM Copy # 1 Date Opened: 09/09/22 Date Notified: 09/09/22 Date Delivered: 09/09/22
	Customer Number:	
	PO Number:	
	Auth Number:	
	Service Writer: Anthony Morales	
	Terms & Conditions:	
Type of Sale: Retail	I acknowledge notice and oral approval of an increase in the original estimated price.	
Customer Signature _____		

Incr. Amt	New Amt	Date	Time	Person Cont.	How Cont.	Phone	Cont. By
Reason:							
Reason:							
Reason:							

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total

Payment in full required prior to release of vehicle.  
 Method of payment we accept: Cash Mastercard Visa Amex  
 Company or Personalized check up to \$2,000.00 with the following:  
 1) C Check guarantee card  
 2) V Valid drivers license  
 3) N Name and address  
 (No. P.O. imprinted on check)

Total Labor	0.00
Total Parts	0.00
Total Sublet	0.00
Misc. Chrgs	0.00
Car Rental	0.00
Freight	0.00
Deductible	0.00
Special Tax	0.00
Haz Mat Chrg	0.00
Sales Tax	0.00


Customer Signature X

**AMOUNT DUE 0.00**

Prop 65 - Warning Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain Replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleansing your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

# Scott Robinson

CHRYSLER DODGE JEEP RAM



Scott Robinson Chrysler Dodge Jeep Ram

20900 Hawthorne Blvd

Torrance, CA 90503

(310) 542-0900

www.scottrobinsonchryslerdodgejeepram.com

B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER VIN: <b>1B3JR65ZX 3V500924</b> License Number: _____ Color: _____ Stock Number: _____ Mileage In: 8207 Tag Number: <b>1246</b> Mileage Out: 8208	A/R Number: _____	Invoice Number <b>342726</b> Printed: SEP 6 22 2:53 PM Copy # 1 Date Opened: SEP 6 22 Date Notified: SEP 6 22 Date Delivered: SEP 6 22
	Customer Number: _____	
	PO Number: _____	
	Auth Number: _____	
	Service Writer: <b>Anthony Morales</b>	
	Terms & Conditions: _____	
	Type of Sale: <b>Retail</b>	
I acknowledge notice and oral approval of an increase in the original estimated price		
Customer Signature _____		

<u>Incr. Amt</u> 760.00	<u>New Amt</u> 1510.00	<u>Date</u> 09/06/22	<u>Time</u> 2:51PM	<u>Original Estimate:</u> \$750.00	<u>Original Estimate:</u> SEP 6 22	<u>Person Cont.</u> Amir	<u>How Cont.</u> Phone	<u>Phone</u> 310710703	<u>Cont. By</u> 990489
Reason: Flag and window regulator install									

Reason: \_\_\_\_\_

Reason: \_\_\_\_\_

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
<b>1. Customer statement of problem</b>					
Customer request replace window regulator and window flag. Both on drivers side					
1 - Cause/Action to Take					
S180 - cust requet to install drivers side flag panel.					
1 - Correction/Action Taken					
pervious visit- removed drivers door panel and inspected- found possible weak spot in window regulator guild channel.					750.00
cust no returning with flag panel and window regulator part.					
removed drivers door panel and removed window regulator retainer bolts- once window regulator loose from door- can see weak spot is broken guide channel.					
removed window regulator.					
removed drivers door flag panel.					
installed cust provided ( used part)					
installed and adjusted new window regulator. verified window operation and sitting in seals.					
installed door panel and installed 2 new push pins.					
Part Number 5GC71DX9AA					
Description NONE PIN	2	2	4.55	9.10	9.10
<u>Sub Total Parts</u>					9.10
SubTotal Job # 1					759.10
<b>2. Customer statement of problem</b>					
ICHRV Vehicle Inspection					
1 - Cause/Action to Take					
ICHRV - Inspection					
1 - Correction/Action Taken					
Performed Multi point inspection					0.00
<u>Sub Total Parts</u>					0.00
SubTotal Job # 2					0.00
<b>3. Customer statement of problem</b>					
TIRE INFLATED TO (PSI) RIGHT FRONT _____ LEFT FRONT _____ RIGHT REAR _____ LEFT REAR _____ TECH (_____)					
1 - Cause/Action to Take					
PSI - PSI					
1 - Correction/Action Taken					
990040					0.00

# Scott Robinson

**CHRYSLER DODGE JEEP RAM**



**Scott Robinson Chrysler Dodge Jeep Ram**

20900 Hawthorne Blvd

Torrance, CA 90503

(310) 542-0900

www.scottrobinsonchryslerdodgejeepram.com

B.A.R. # ARD269409 EPA # CAD981574197



Year/Make/Model: 2003 Dodge VIPER  
 VIN: **1B3JR65ZX 3V500924**  
 License Number: \_\_\_\_\_ Color: \_\_\_\_\_  
 Stock Number: \_\_\_\_\_ Mileage In: 8207  
 Tag Number: **1246** Mileage Out: 8208

A/R Number: \_\_\_\_\_  
 Customer Number: \_\_\_\_\_  
 PO Number: \_\_\_\_\_  
 Auth Number: \_\_\_\_\_  
 Service Writer: **Anthony Morales**  
 Terms & Conditions: \_\_\_\_\_  
 Type of Sale: **Retail**

Invoice Number  
**342726**  
 Printed: SEP 6 22 2:53 PM  
 Copy # **1**  
 Date Opened: SEP 6 22  
 Date Notified: SEP 6 22  
 Date Delivered: SEP 6 22

I acknowledge notice and oral approval of an increase in the original estimated price

Customer Signature

Original Estimate: \$750.00

Original Estimate: SEP 6 22

Incr. Amt	New Amt	Date	Time	Person Cont.	How Cont.	Phone	Cont. By
760.00	1510.00	09/06/22	2:51PM	Amir	Phone	310710703	990489

Reason: Flag and window regulator install

Reason:

Reason:

Description	QtyOrd	Qty Del	Price	Ext Total	Grand Total
Set all tires to specified air pressure					
<u>Sub Total Parts</u>					<u>0.00</u>
<u>SubTotal Job # 3</u>					<u>0.00</u>
<u>Miscellaneous Charges and Deductions For All Jobs</u>					

Payment in full required prior to release of vehicle.  
 Method of payment we accept: Cash Mastercard Visa Amex  
 Company or Personalized check up to \$2,000.00 with the following:  
 1) C Check guarantee card  
 2) V Valid drivers license  
 3) N Name and address  
 (No. P.O. imprinted on check)

Total Labor	750.00
Total Parts	9.10
Total Sublet	0.00
Misc. Chrgs	0.00
Car Rental	0.00
Freight	0.00
Deductible	0.00
Special Tax	0.00
Haz Mat Chrg	0.00
Sales Tax	0.86

Customer Signature X

**AMOUNT DUE 759.96**

Prop 65 - Warning Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain Replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleansing your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

**Scott Robinson Chrysler Dodge Jeep Ram**  
20900 Hawthorne Blvd  
Torrance, CA 90503  
(855) 301-2211

**RECEIPT**

**Invoice Details:**

Invoice #: YIDM4TMTFE

Invoice Date: Tuesday, September 06, 2022 04:15  
PM

Repair Order/Ref #: 342726

---

Description of Product/Services	Amount
Service Performed	\$ 759.96

---

**Payment Details:**

Paid On: Tuesday, September 06, 2022 04:16  
PM

Card Type: Visa  
Payment Type: Chip

-----  
Customer Signature

Dealer Associate: Anthony Morales  
Cashier: Anthony Morales

THANK YOU!

---

Scott Robinson Chrysler Dodge Jeep Ram

Processed by myKaarma eBridge Payments




1429 W. Scott Ave Gilbert, Az 85233

Date	Order #
Oct 14th 2022	821839

Bill To:
[Redacted]

Ship To:
[Redacted]

Products	Model	Tax	Total
1x VR Tuned ECU Flash Tune Dodge Viper 8.3L V10 2003-2006	VRT-VIP-83L	0%	\$700.00
 1x HP Tuners 1 Universal Credit for MPVI2+	UC-0001	0%	\$47.49

### Order Notes

Shipping Total: \$20.31  
Shipping Discount: \$20.31  
Coupon Discount: \$0.00  
Line-Item Discount: \$100.00  
Line-Item Total: \$747.49  
Tax Exempt: \$0.00  
Total: \$747.49

Payments/Credits: \$0.00  
Balance Due: \$747.49

### FOR INFO ON SHIPPING CONTACT: TRACKING@VIVIDRACING.COM

By Ordering you agree to all of our terms listed at [www.vividracing.com](http://www.vividracing.com) - For a refund, the product must be recieved at Vivid Racing within 15 days of purchase date, in new condition identical to how you recieved it and will be subject to a 25% restocking fee. Refused shipments are subject to a 25% restocking fee. No returns, cancellations or refunds allowed on special order items. Please inspect your merchandise BEFORE you sign for delivery. Do not sign or accept a package if it shows damage or is open at all as the freight company will not pay for reimbursement.

We appreciate your business and look forward to seeing you again soon.

Thanks,  
**Austin Smith at Vivid Racing**  
(480) 966-3040 | [austin@vividracing.com](mailto:austin@vividracing.com)

Vivid Racing, 1429 W Scott Ave, Gilbert, AZ 85233




1429 W. Scott Ave Gilbert, Az 85233

Date	Order #
Aug 25th 2022	797338

Bill To:
[Redacted]

Ship To:
[Redacted]

Products	Model	Tax	Total
 1x BC Racing BR Type Coilovers Dodge Viper 2003-2010	Z-03-BR	0%	\$1,375.00

### Order Notes

Shipping Total:	\$59.80
Shipping Discount:	\$59.80
Coupon Discount:	\$0.00
Line-Item Discount:	\$35.00
Line-Item Total:	\$1,375.00
Tax Exempt:	\$0.00
Total:	\$1,375.00

Payments/Credits:	\$1,375.00
Balance Due:	\$0.00

### FOR INFO ON SHIPPING CONTACT: TRACKING@VIVIDRACING.COM

By Ordering you agree to all of our terms listed at [www.vividracing.com](http://www.vividracing.com) - For a refund, the product must be received at Vivid Racing within 15 days of purchase date, in new condition identical to how you received it and will be subject to a 25% restocking fee. Refused shipments are subject to a 25% restocking fee. No returns, cancellations or refunds allowed on special order items. Please inspect your merchandise BEFORE you sign for delivery. Do not sign or accept a package if it shows damage or is open at all as the freight company will not pay for reimbursement.

We appreciate your business and look forward to seeing you again soon.

Thanks,  
**Austin Smith at Vivid Racing**  
(480) 966-3040 | [austin@vividracing.com](mailto:austin@vividracing.com)

Vivid Racing, 1429 W Scott Ave, Gilbert, AZ 85233




1429 W. Scott Ave Gilbert, Az 85233

Date	Order #
Sep 2nd 2022	801796

**Bill To:**

**Ship To:**

Products	Model	Tax	Total
 1x Belanger Headers And Side Pipe kit Dodge Viper V10 03-06 ***This product is for Racing Competition only and is not legal for use in highway or street vehicles or other non-racing competition off-road vehicles***	5508	0%	\$3,750.00
1x Shop Labor (add description)	Shop Labor	0%	\$500.00

**Order Notes**

2022-09-02 12:04:35 pm MST  
 ETA Oct 21nd for dropoff. Need car early in the morning.

Shipping Total: \$106.46  
 Shipping Discount: \$106.46  
 Coupon Discount: \$0.00  
 Line-Item Discount: \$-140.00  
 Line-Item Total: \$4,250.00  
 Tax Exempt: \$0.00  
 Total: \$4,250.00

Payments/Credits: \$1,875.00  
 Balance Due: \$2,375.00

**FOR INFO ON SHIPPING CONTACT: TRACKING@VIVIDRACING.COM**

By Ordering you agree to all of our terms listed at [www.vividracing.com](http://www.vividracing.com) - For a refund, the product must be recieved at Vivid Racing within 15 days of purchase date, in new condition identical to how you recieved it and will be subject to a 25% restocking fee. Refused shipments are subject to a 25% restocking fee. No returns, cancellations or refunds allowed on special order items. Please inspect your merchandise BEFORE you sign for delivery. Do not sign or accept a package if it shows damage or is open at all as the freight company will not pay for reimbursement.

We appreciate your business and look forward to seeing you again soon.

Thanks,  
**Austin Smith at Vivid Racing**  
 (480) 966-3040 | [austin@vividracing.com](mailto:austin@vividracing.com)

Vivid Racing, 1429 W Scott Ave, Gilbert, AZ 85233




## Viper Parts Rack America - Order Confirmation for Order #110148

Amir, thanks for your order! Please save this email for your records.

Billing Address
[Redacted]

Shipping Address
[Redacted]

Description	Options	Unit Price	Total
<a href="#">009:2003 - 2017 Dodge Viper SRT10 Left Window Regulator - 04865611A</a> 	Base Price:	\$825.00	
Quantity: 1 @		\$825.00	\$825.00
Payment Method: Visa		Product total:	\$825.00
		Shipping total:	\$0.00
		Handling Fee:	\$25.75
		<b>Grand total:</b>	<b>\$850.75</b>

Viper PartsRack America  
32 Dougan Falls Lane

\$1680 all-in-delivered, thanks. OnTrac delivery tracking later today.

PS: I substituted the Gen 5 'bigfoot' Rears at same price, Fit and Look GREAT, and are 10mm wider than G3-4.

